1999 Pontiac Firebird [2g2fv22g4x2235970] Camaro, Firebird VIN F Service Manual Bulletins By Category Information Document ID: 753986

#00-08-110-004: Rear Quarter Trim Gaps to the B-Pillar (Insert Screw) - (Oct 11, 2000)

Rear Quarter Trim Gaps To The B-Pillar (Insert Screw) Subject:

Models: 1998-2000 Chevrolet Camaro (Coupe) 1998-2000 Pontiac Firebird (Coupe)

Condition

Some customers may comment that the rear quarter trim panel gaps to the B-Pillar.

Correction

1. Pull the rear quarter trim speaker cover.


Figure 1


2. Make sure the quarter trim panel is seated to the Velcro attachment points. See Figure 1.

Figure 2

© 2011 General Motors. All rights reserved.



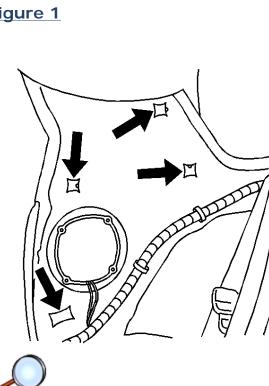

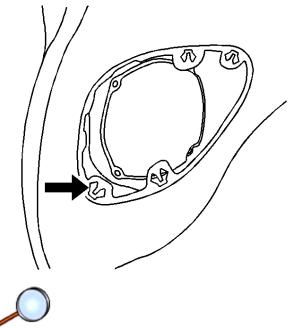

- 3. Drill and insert the screw to secure the trim panel to the body. See location shown in Figure 2.
- 4. Reinstall speaker cover.

Parts Information

Part Number	Description
11519838	Screw

Parts are currently available from GMSPO.

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
R0920 (RH)	Grille, Radio Speaker (Rear) - R & R	0.2 hr
R0921 (LH)		

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.

